Configuring Your PC For ATI OKI Sublimation Toner Specific To A Graphic Application

Figure 1

Right-click

All examples are showing OKI 5200 on Windows XP.

1. Install your ATI laser sublimation profile.

After you download the file **ATISUBPROFILE_OKI_r0806.icm** place it in the folder
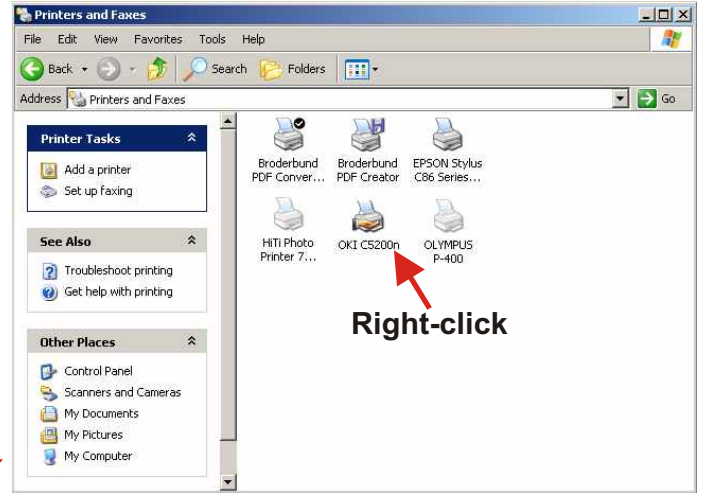
C:\WINDOWS\system32\spool\drivers\color

2. Locate your OKI printer driver.

Windows 2000

From the PC Desktop select
Start> Settings> Printers.

Windows XP

From the PC Desktop select
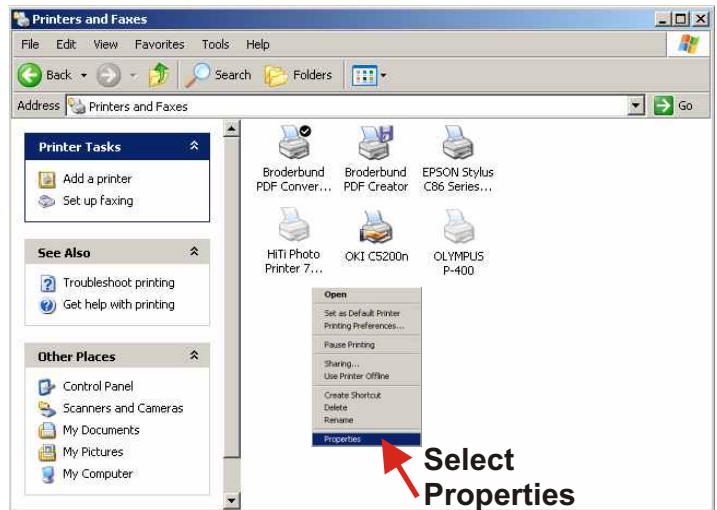**Start> Printers And Faxes.**

3. Right-click on your OKI printer used for sublimation.

Reference Figure 1 on the right.

4. Select **Properties** from the pop-up menu.

Reference Figure 2 on the right.

Figure 2

Select Properties

5. OKI Print Driver Setup

Make sure the **General** Tab is selected.

Click on **Printing Preferences**.

Reference Figure 3 on the right.

Figure 3

Click Here

Figure 4

6. OKI Printing Preferences

Click Setup if not already displaying.

Select the following in the media section.

Size> Letter 8.5 x 11

Note: For legal paper you can change this later when you go to print.
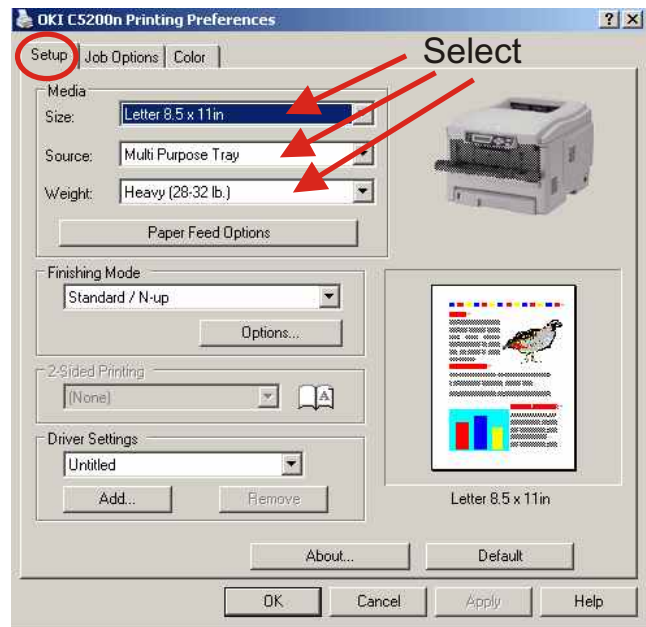
Source> Multi Purpose Tray

Note: For Tray 1 selection you can change this later when you go to print.

Weight> Heavy (28-32 lb.)

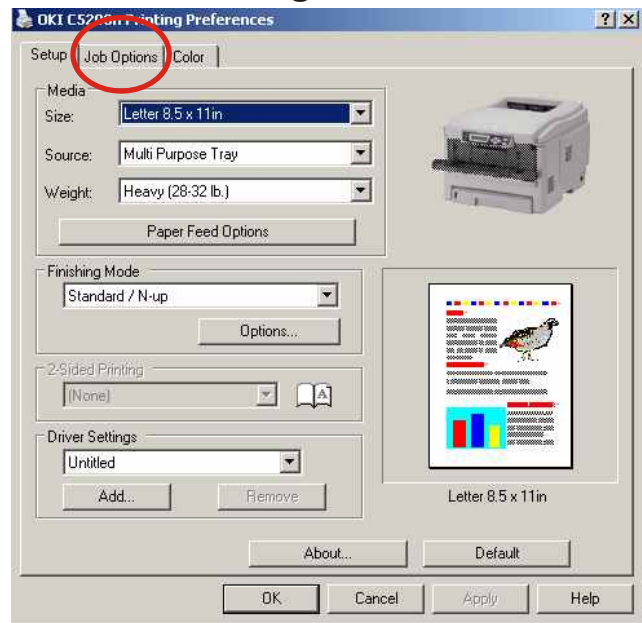Note: This setting should never change.

Reference Figure 4 on the right.

Figure 5

7. Job Options

Locate the **Job Options** Tab and select.

Reference Figure 5 on the right.

Figure 6

8. Job Options Settings
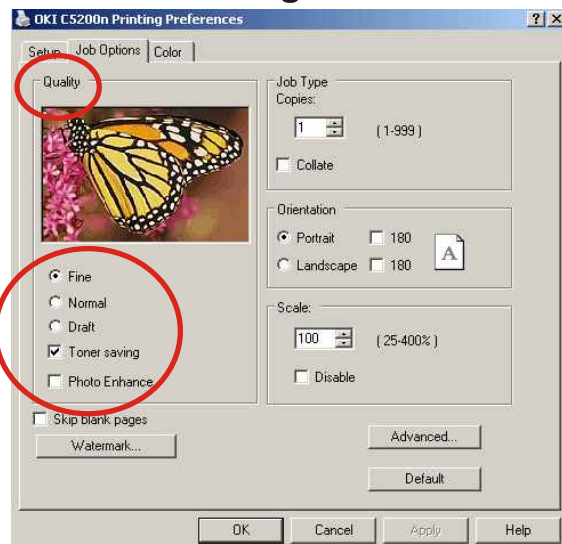
In the **Quality** section.

Select **Fine.**

Select **Toner Saving.**

All other selections are not selected.

Note: Toner Saving may be changed later depending on paper selection and substrate.

Reference Figure 6 on the right.
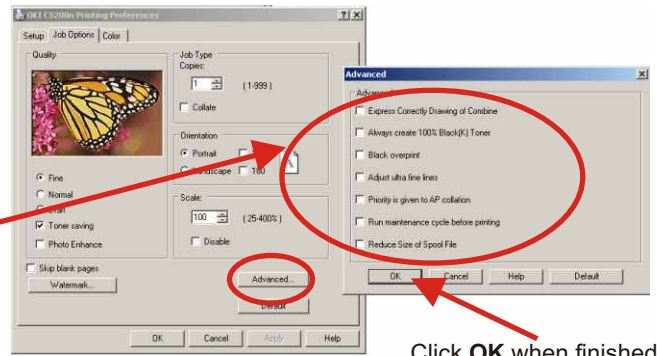
Figure 7

9. Job Options Advanced Settings

Select the **Advanced** button, another panel will appear.

Uncheck all selections.

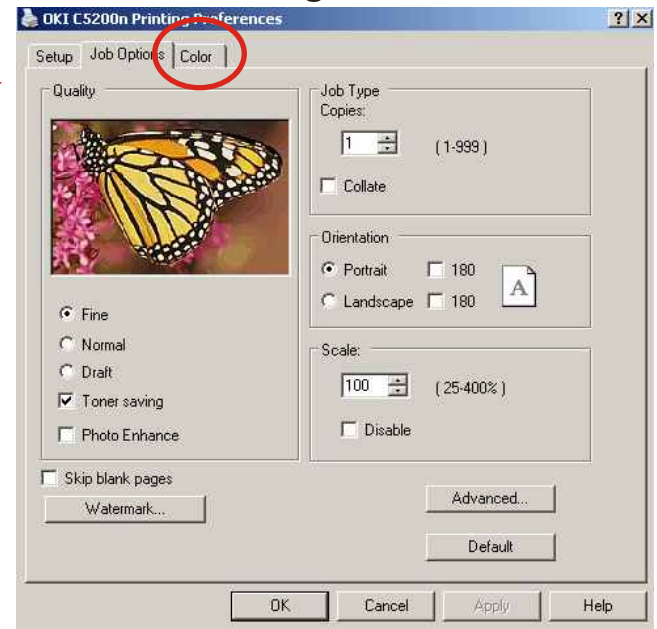Click **OK** when finished.

Reference Figure 7 on the right.

Click **OK** when finished.

Figure 8

10. Color

Locate the **Color** Tab and select.

Reference Figure 8 on the right.

Figure 9

11. Color Settings

In the **Color Mode** section select **Advanced Color**.

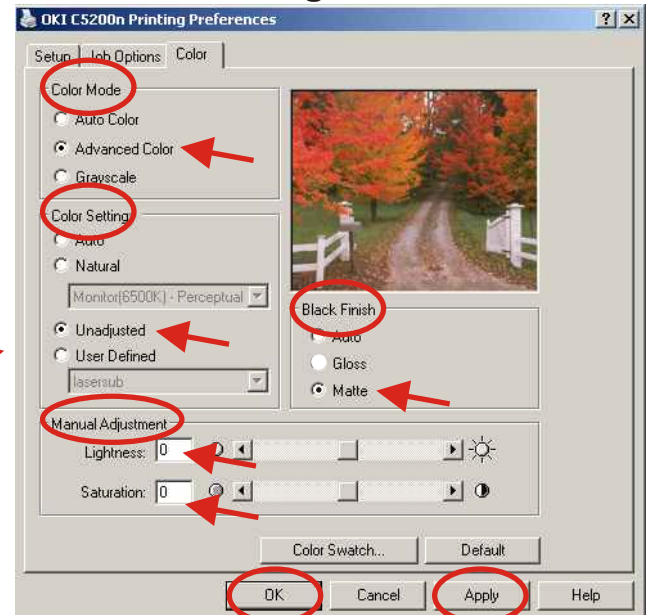In the **Color Setting** section select **Unadjusted**.

In the **Black Finish** section select **Matte**.

In the **Manual Adjustment** section set both **Lightness** and **Saturation** to **0** (Default).

Click **Apply** and then **OK**

Reference Figure 9 on the right.
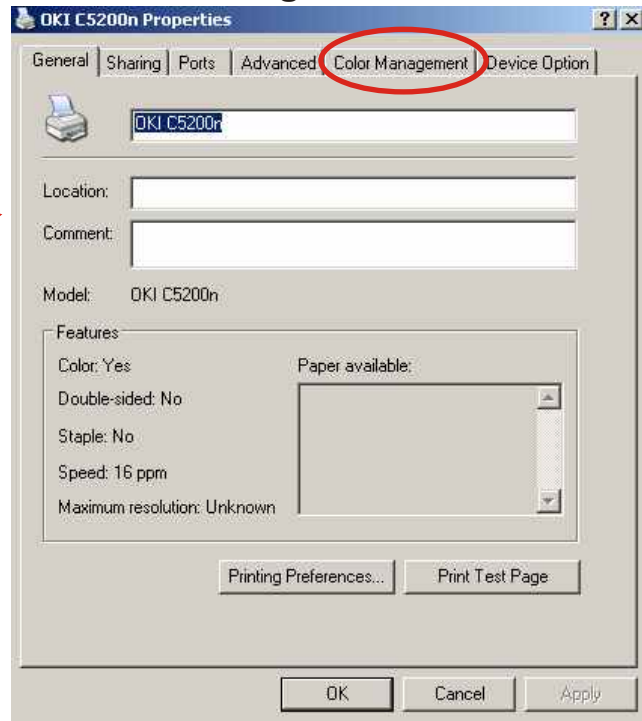
Figure 10

12. Color Management

After clicking Apply and OK from step 11 you should
be returned to the OKI Printer Properties Panel.

If not please repeat steps 2 - 4.

Select the **Color Management** Tab.

Reference Figure 10 on the right.

Figure 11
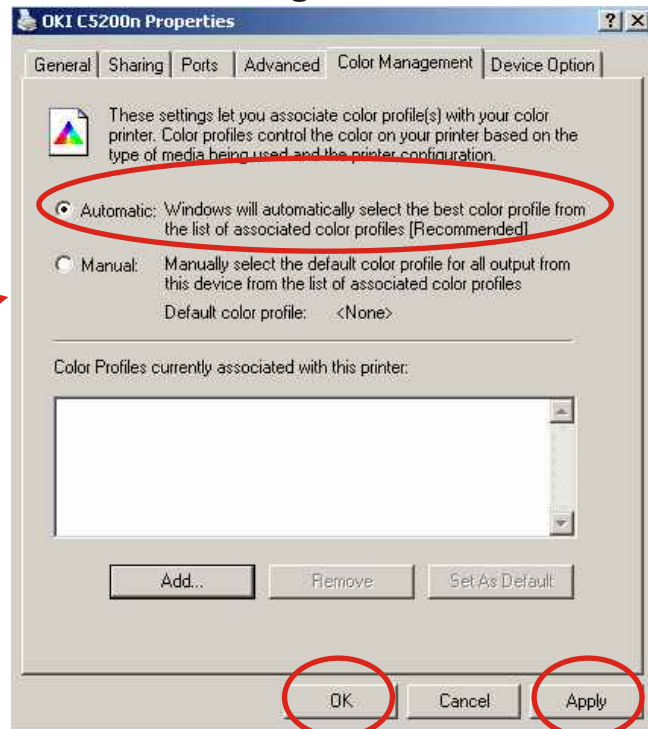
13. Color Management Settings

Select **Automatic**.

Click **Apply** and then **OK**.

Note: If you had never configured this before Automatic
is the default and the Apply button may be grayed out,
in this case just click OK.

Reference Figure 11 on the right.

**You are now ready to configure your specific graphics application.
Please make sure you have the correct guide downloaded for your application**